


RX-7

SUBJECT Air Conditioner Indicator Light.

DESCRIPTION

Some air conditioner kits manufactured by Lone Star Manufacturing Company may contain incorrectly assembled harness connectors.

If the indicator light on the air conditioner switch does not illuminate, or illuminates dimly after installation, the problem may be due to incorrectly assembled G-03 or G-16 connectors.

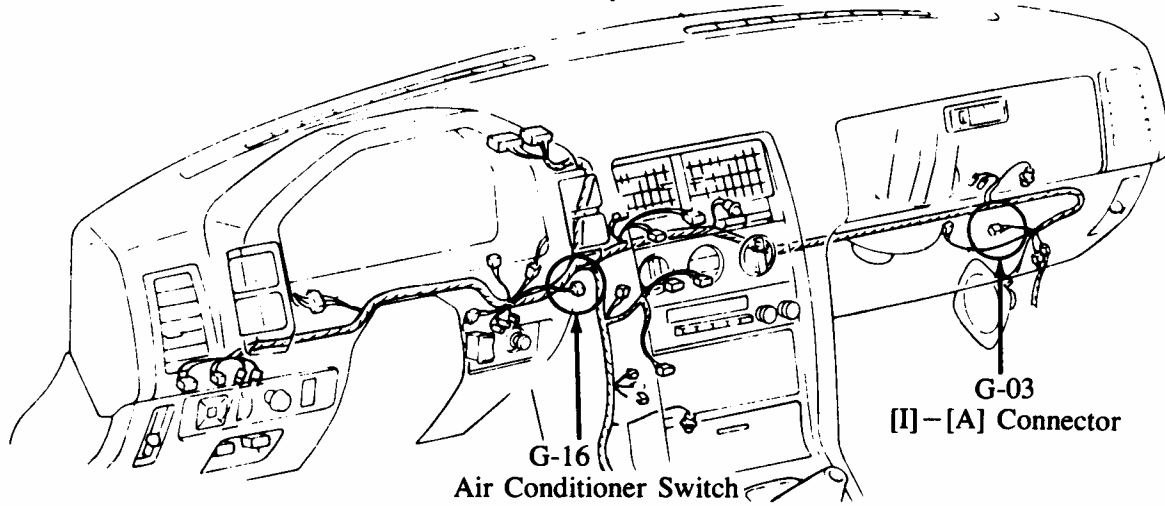

109

REPAIR PROCEDURE

1. Check that the G-03 accessory connector (A) is assembled correctly as viewed from the harness side of the connector. If not, remove the incorrect terminals and reassemble according to the connector diagram.
2. Check that the G-16 accessory connector (A) is assembled correctly as viewed from the harness side of the connector. If not, remove the incorrect terminals and reassemble according to the connector diagram.

