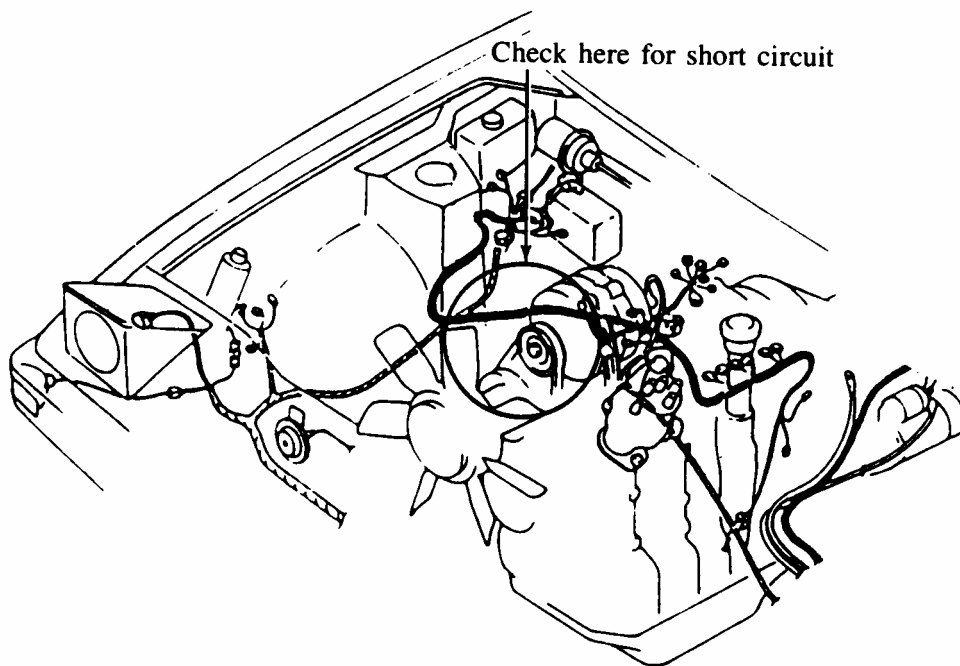


1979-1984 RX-7

SUBJECT Engine Harness.DESCRIPTION

If the "ENGINE" fuse blows, preventing the engine from starting, the problem may be due to an electrical short circuit in the engine harness. Carefully inspect and repair the engine harness, if necessary, in the area of the thermostat and air hose to the air cleaner.

To prevent short circuiting, the clearance between the engine harness and the air hose to the air cleaner has been increased since the production of October 1, 1984.

VIN OF PRODUCTION CHANGE

RX-7:

JM1FB33 E0866965

October 1, 1984