


RX-7 (13B)

SUBJECT Filter for the Vent Solenoid Valve.

DESCRIPTION

To prevent high idle speed or idle speed hunting caused by a sticking vent solenoid valve, an air filter has been installed between the dynamic chamber and vent solenoid valve since the production date of March, 1985.

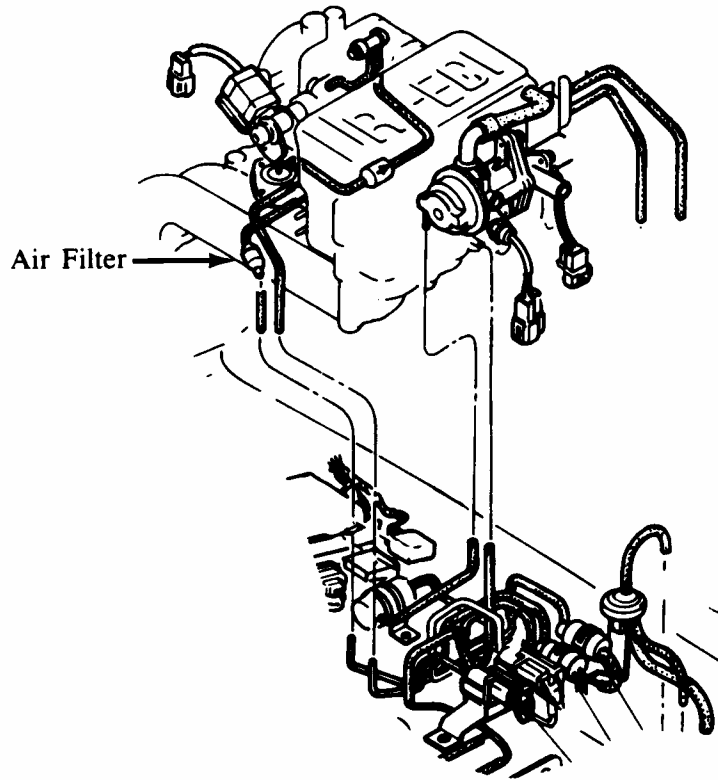

VIN OF PRODUCTION CHANGE

RX-7 (13B):

JM1FB332 F0889474

March, 1985

PARTS INFORMATION

*Filter Set: 8AF1 13 SGY

*Set Component Parts:

PART NAME	QTY
Vacuum Hose	2
Air Filter	1
Vacuum Diagram Label	1

PART NUMBER		DESCRIPTION	QTY		INTERCHANGEABILITY
NEW	OLD		NEW	OLD	
N236 13 253A	N304 13 245	Vacuum Hose	2	1	NO
N304 20 308	—	Air Filter	1	—	NO
N304 69 044C	N304 69 044B	Vacuum Diagram Label	1	1	NO
* 8AF1 13 SGY	—	Filter Set	1	—	NO

NOTE:

The air filter kit has also been established as a service part for the vehicle produced prior to this production change. If high idle speed or idle speed hunting is caused by the malfunction of the vent solenoid valve, install the air filter and attach the vacuum diagram lable at the same time of replacing the vent solenoid valve. See Service Bulletin Category 4, 008/84 for additional information.*

Attach vacuum diagram label

