

1980-1985 RX-7 & 1981-1985 GLC


SUBJECT Whistle Noise from Check & Cut Valve.

DESCRIPTION

Modified check & cut valves are available as service parts for 1981-1985 RX-7 and 1982-1985 GLC in order to prevent a whistle noise. The whistle noise tends to occur from the check & cut valve at high temperature and low fuel level, and can be heard from the rear of the vehicle.

If a customer complains about the whistle noise, replace the check & cut valve with the modified one.

The part numbers of 8341-42-910 for RX-7/GLC and BA01-42-910 for GLC have not been changed, however, a modified check & cut valve can be distinguished from an unmodified one by the production date stamped on the bracket as shown.

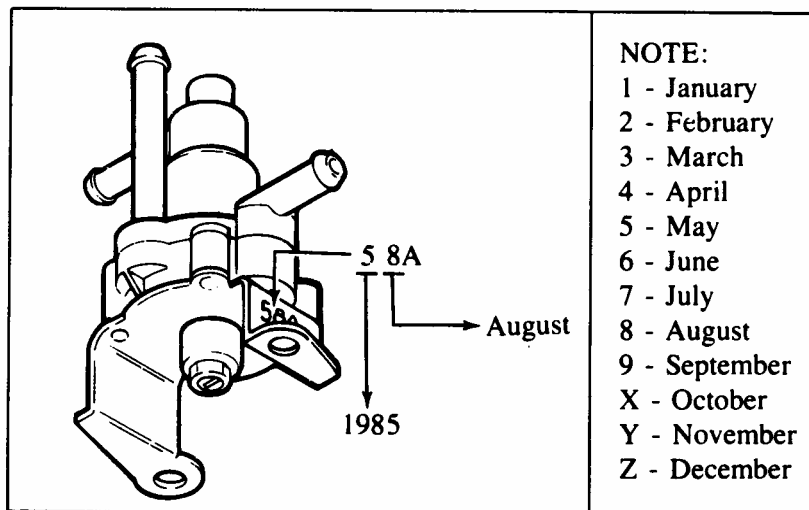

The check & cut valves produced on and after the following date are the modified ones.

RX-7 August 10, 1985 (58A)
GLC September 1, 1984 (49A)

With regard to GLC, the modified check & cut valve has been already installed since the production of September 1, 1984.

VIN OF PRODUCTION CHANGE

GLC Sedan:	JM1BD221 F0806474	September 1, 1984
3-Door Hatchback:	JM1BD231 F0806124	September 1, 1984
5-Door Hatchback:	JM1BD241 F0800198	September 1, 1984

PARTS INFORMATION

PART NUMBER	DESCRIPTION	APPLIED MODEL
8341 42 910	Check Valve	1980-85 RX-7 1981 GLC
BA01 42 910	Check Valve	1982-85 GLC